


MASSO G3 + VFD Wiring Schematic

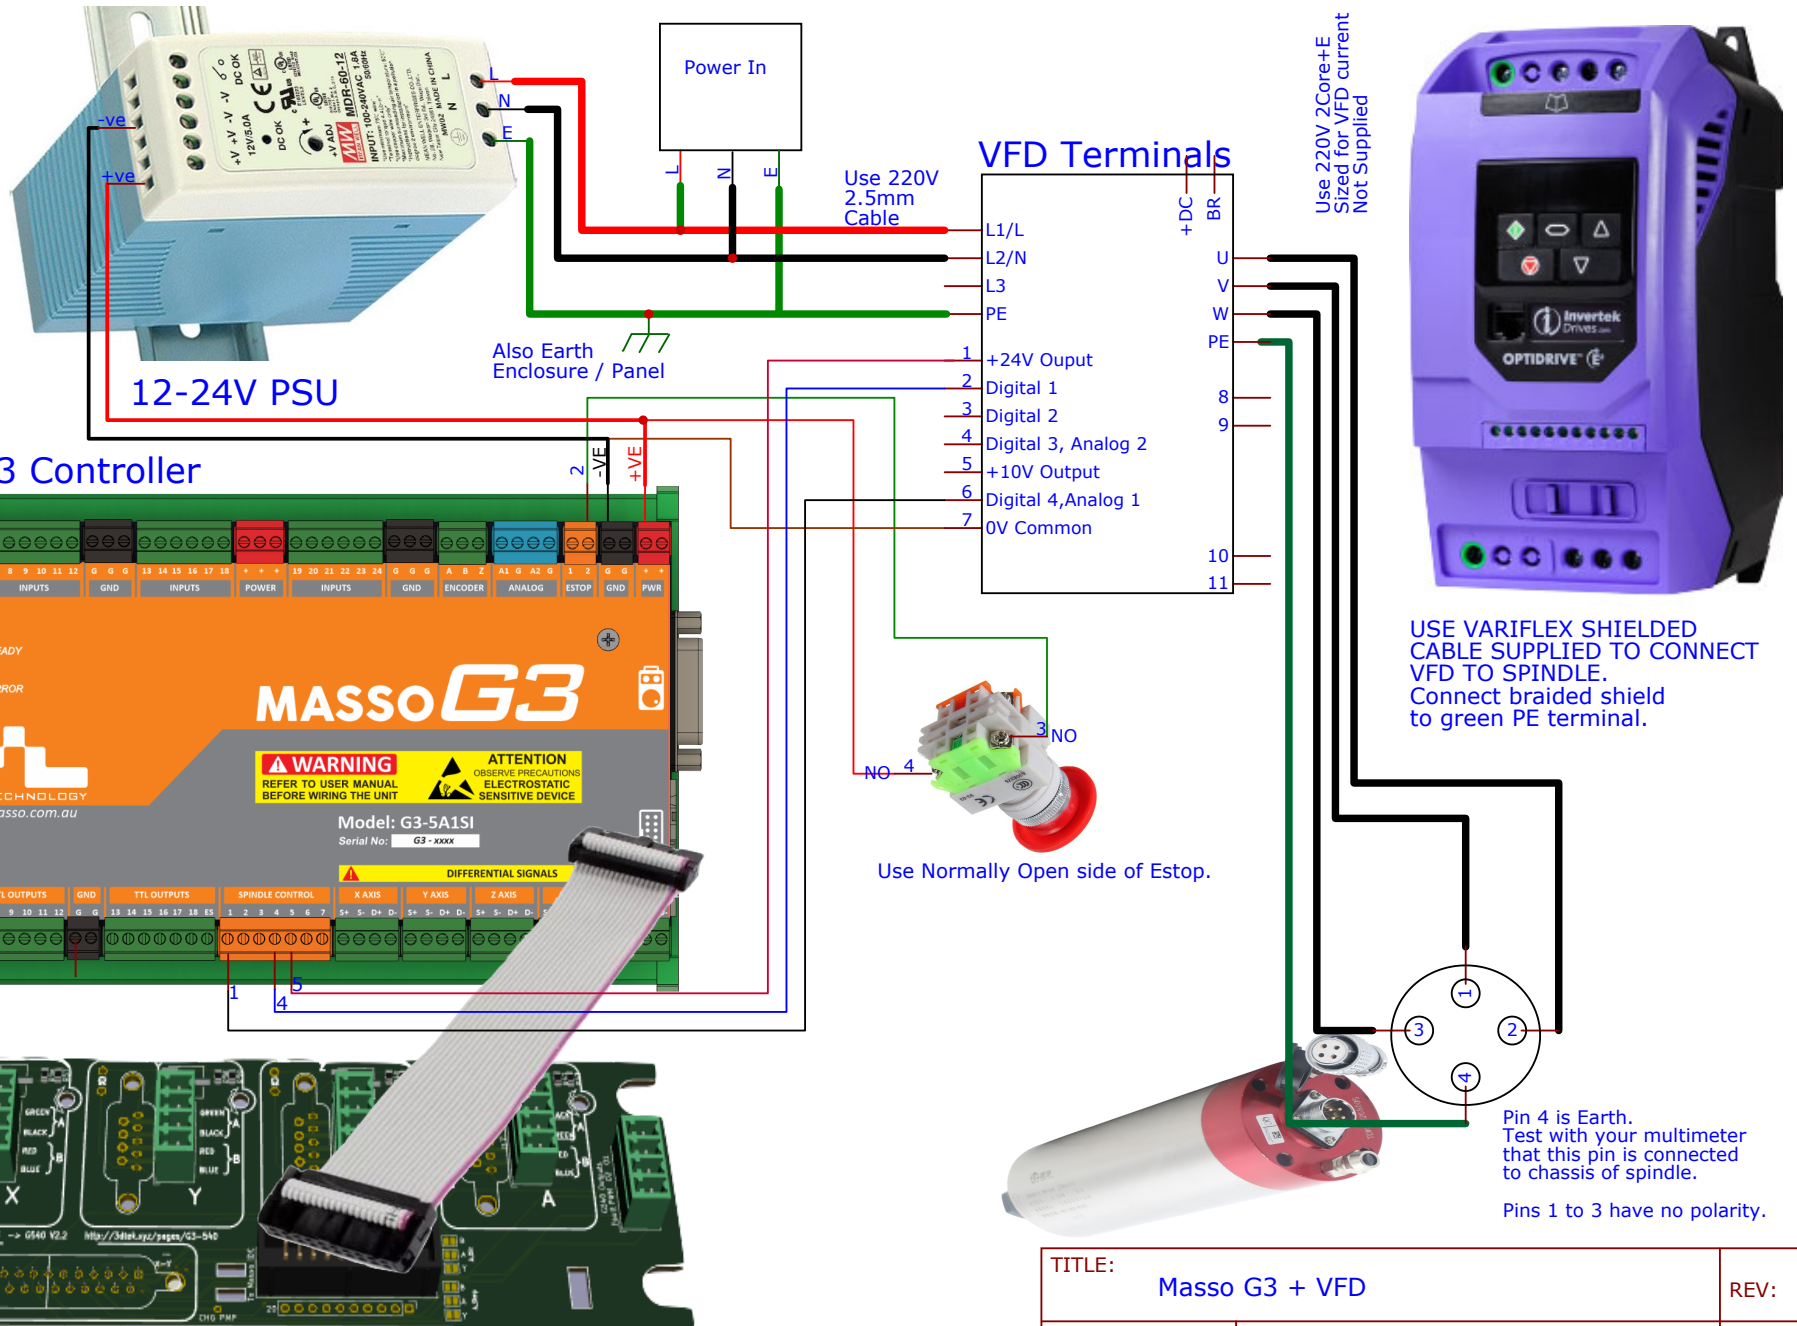


Masso => Gecko Connector

TITLE: Masso G3 + VFD		REV: 1.7
	Company: 3DTek	Sheet: 1/1
	Date: 15/04/2020	Drawn By: 3DTek

MASSO G3 Limit Switch Wiring

X Axis Max Limit X Axis Min Limit Y Axis Max Limit Y Axis Min Limit Z Axis Max Limit

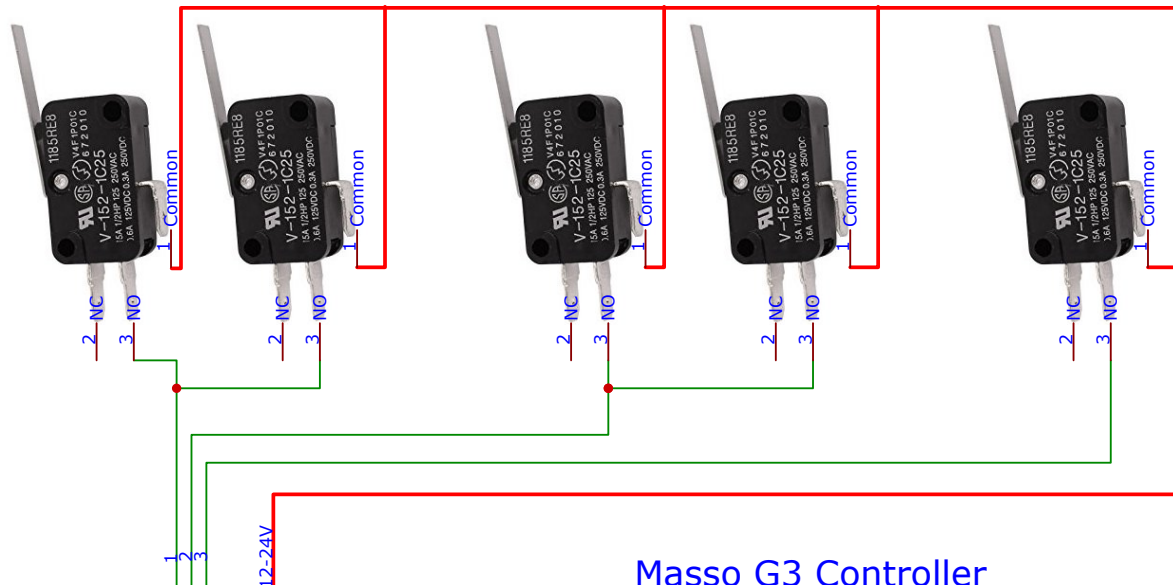

Homing Switch Setup:
NO Normally Open Wiring
Limit switches are shown wired normally open.

Masso G3 Controller



TITLE: Masso G3 Limit Switches		REV: 1.4
	Company: 3DTek	Sheet: 1/1
	Date: 2019-11-17	Drawn By: 3DTek


GECKO G540 Stepper Wiring (c) - Using Gecko Motor Breakout Adaptor

X Axis Stepper


Y Axis Stepper

Z Axis Stepper

A (2nd Y) Axis Stepper

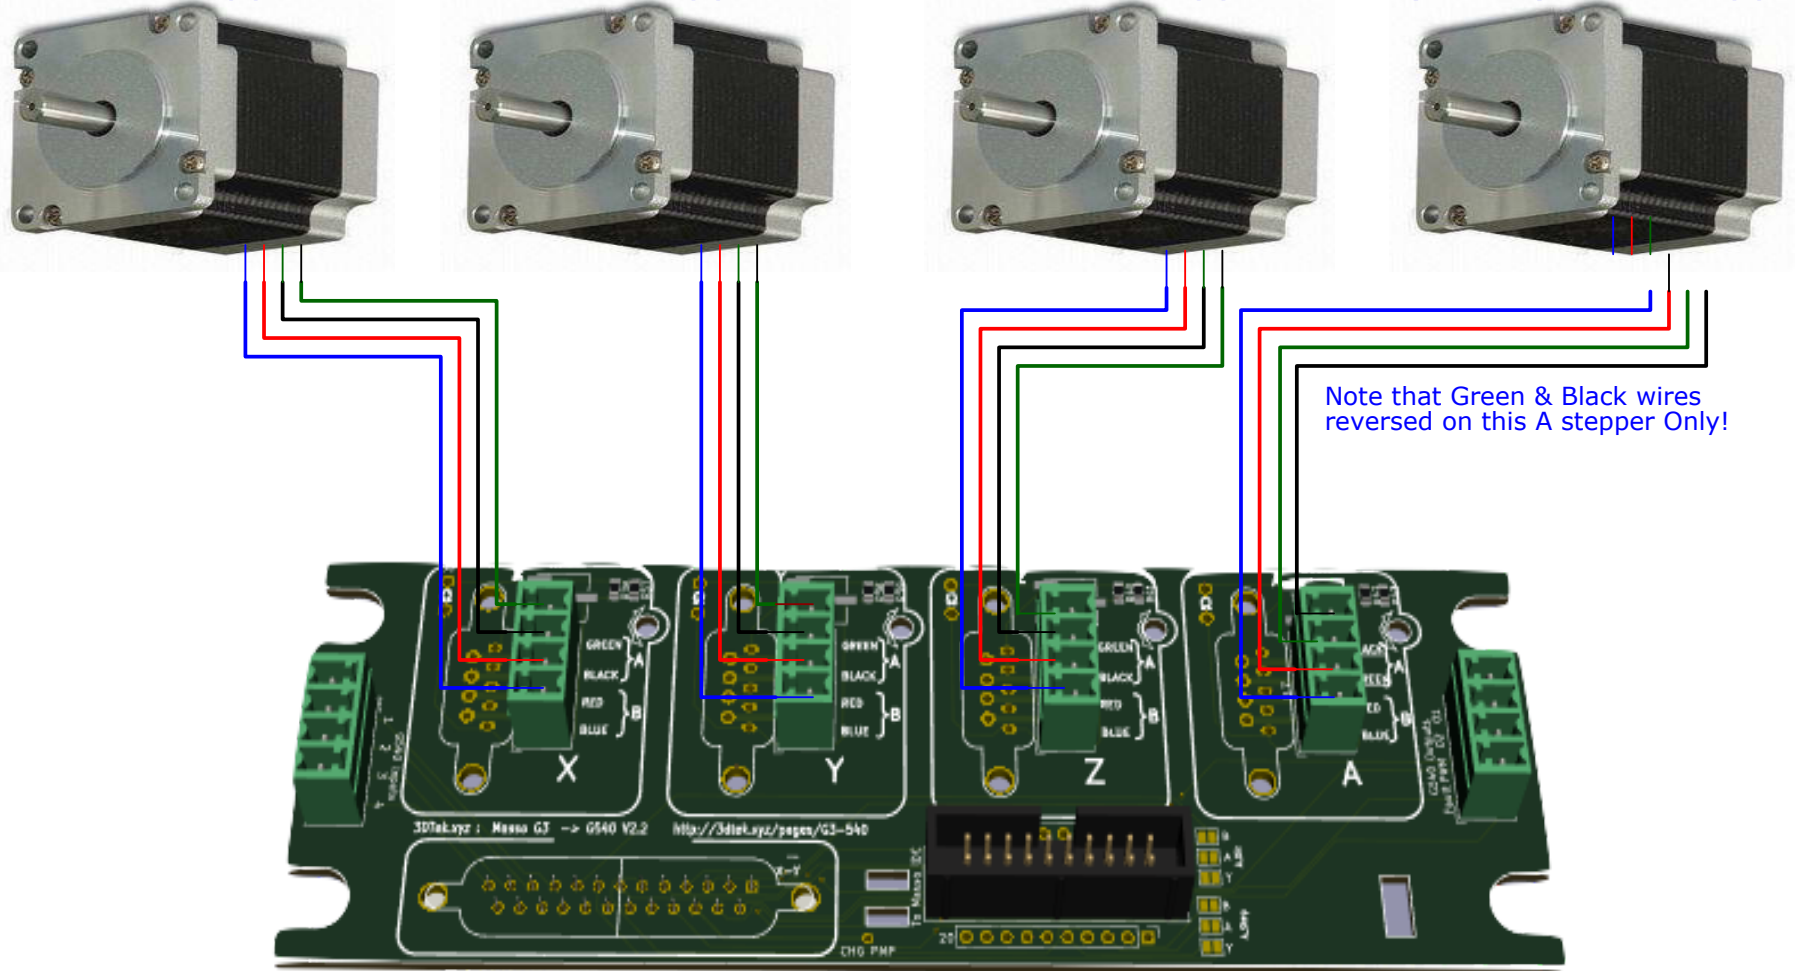


Masso => Gecko Connector

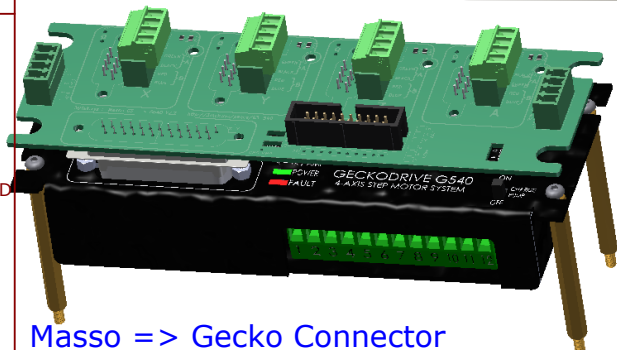

Masso => Gecko Connector
shown installed atop Gecko G540

TITLE: Gecko & Motor Breakout		REV: 1.5
	Company: 3DTek	Sheet: 1/1
	Date: 15/04/2020 Drawn By: 3DTek	

GECKO G540 Power Connections

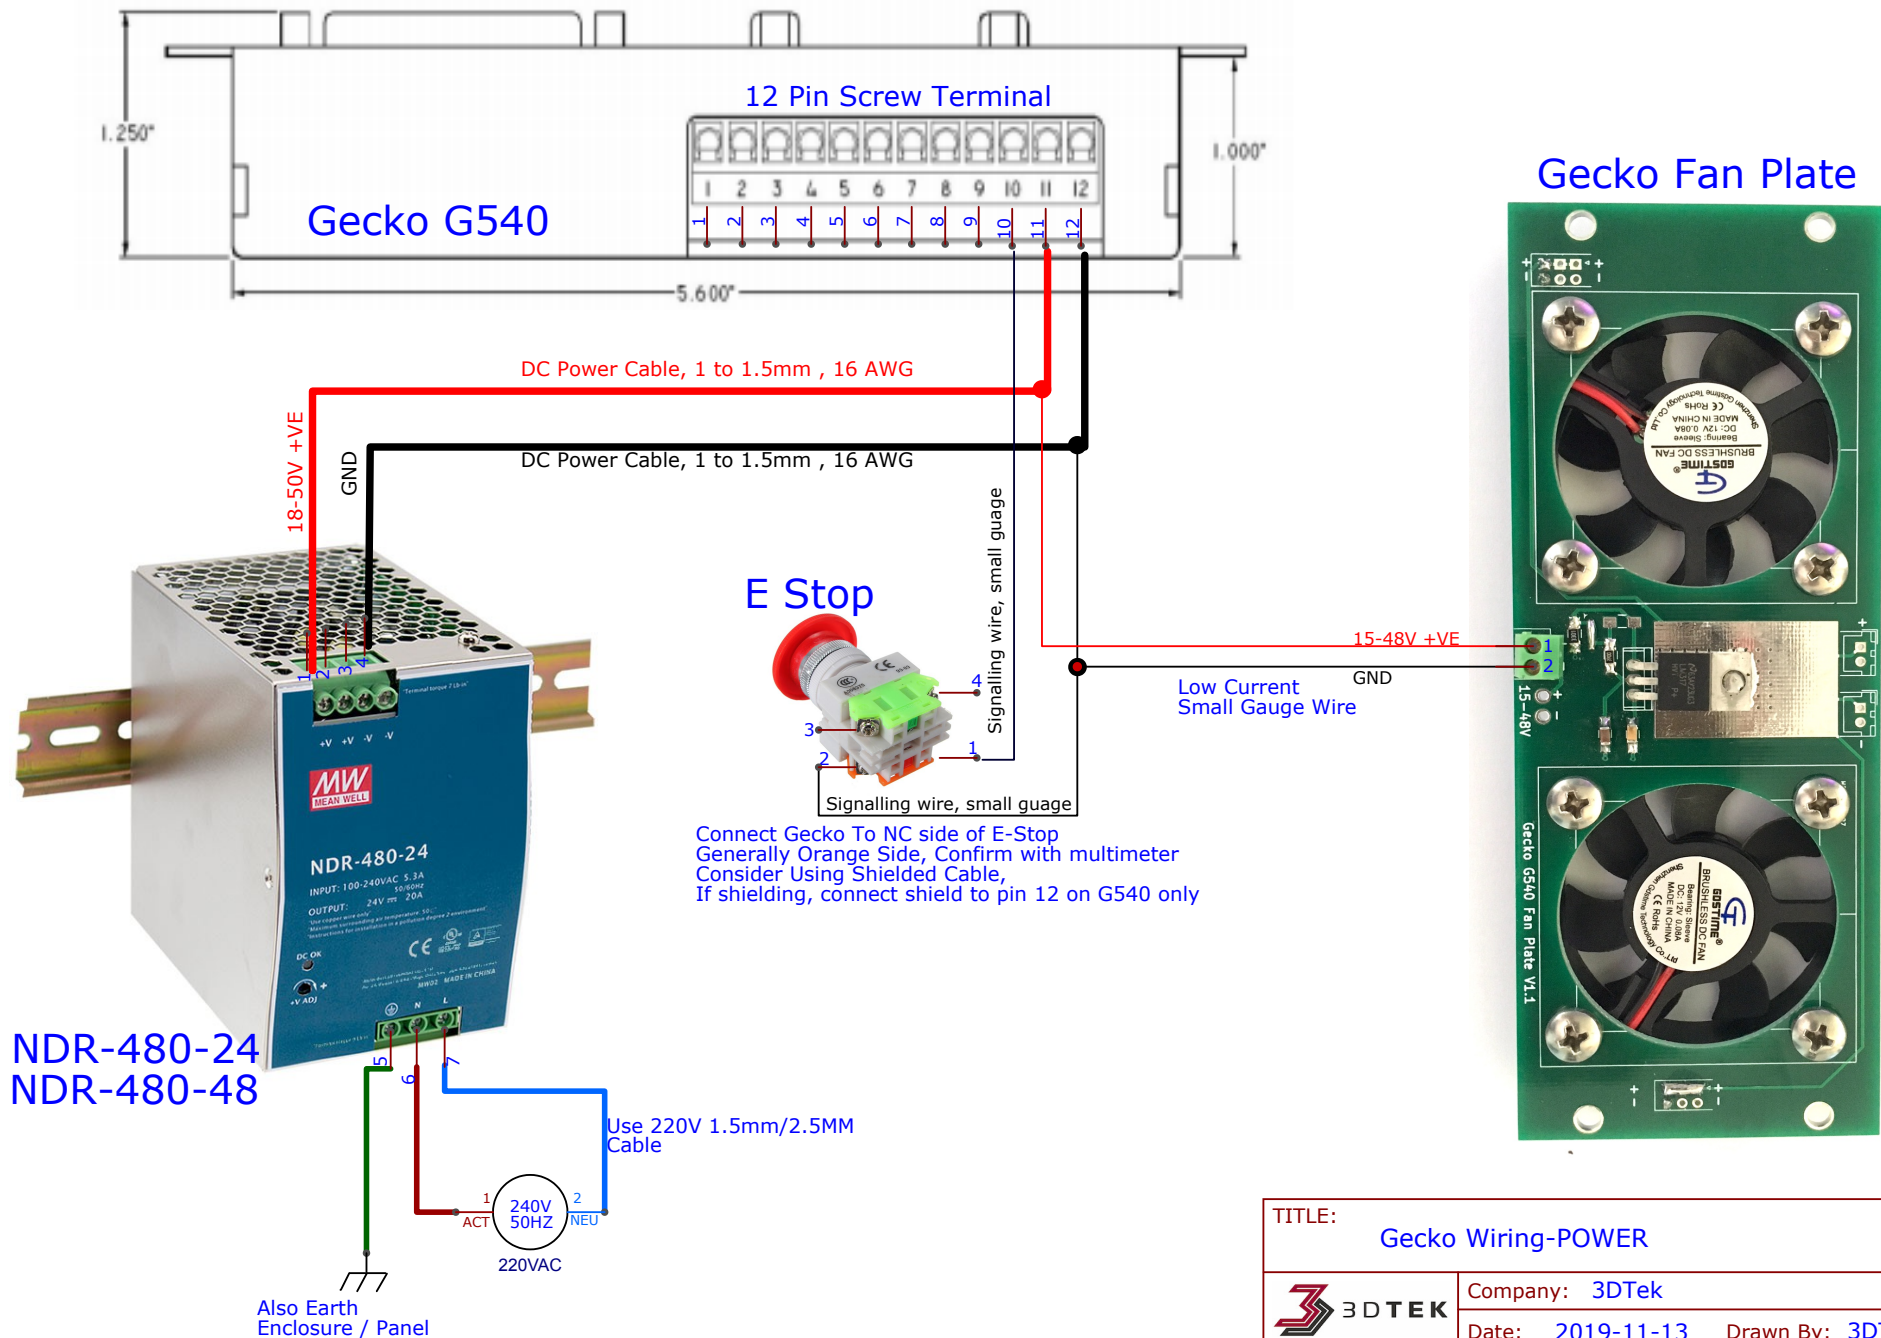

TITLE: Gecko Wiring-POWER		REV: 1.3
	Company: 3DTek	Sheet: 1/1
	Date: 2019-11-13	Drawn By: 3DTek